

Release Notes

Phaser 3600

General Release 1.70.02.48



Release Date: October 2012

Software Release Details

| Component | Version |
|-----------|--|
| Firmware | OS: 1.70.02.48 Engine: 1.10.75 PCL5e: 6.08.01.03.02 PCL6: 5.98 PS: 3.87.00.99.00.90 Network: V4.01.22 |



Purpose

NOTE: This firmware contains a digital signature. Once this firmware is installed on a Phaser 3600 you will not be able to downgrade to previous unsigned versions of firmware.

In order to upgrade your firmware, verify Software Upgrade is Enabled:

1. Access the web page of the device.
2. Go to Properties > Security > Upgrade Management
3. If Sys Admin credentials are set, key in when prompted.
[Default state for Software Upgrade = disabled. The 'Enabled' check box is empty.]
4. Check the Enable box in order to allow software upgrades.
A pop up will display "Your Selections have been modified successfully."

For best security leave this control set to disabled after upgrading your software. The control must be set to enabled prior to doing a software upgrade.

This release addresses the following:

| Media Handling | Font Management |
|--|--|
| The setting of Tray1(MPT) paper size/type was not cleared as a default by the memory clear | downloaded PCL bar code fonts do not print correctly |
| LUI displaying "Load Manually press Stop key" message even if Tray1 is empty | A font file sent to the 3600 with the location set to 0 (printer hard disk) causes the device to lock up |

| | |
|---|---|
| P3600 Printer incorrectly prompts user to load tray 3 Paper Type Mismatch | Multiple fonts sent to the 3600 using the FMU causes the device to lock up. It has a stack over flow. SAP Barcode does not print |
| Media Size in MPT is requested when printing from Paper Source default. | Does not display fonts down loaded |
| Setting for Tray 1 / MPT Type doesn't work | PS Fonts not loading on printer |
| Cannot change the printer default paper size | Security |
| Customer's job is supposed to print page 1 on red paper and all other pages on plain white. | OPBU00251612 - Add Software Upgrade Enable/Disable switch to CWIS |
| MS Word jobs that request trays with different media type in the same job do not print correctly | Provide digitally signed software upgrade files. |
| PDL support | Add the ability to configure Software Upgrade via SNMP. |
| Need to Support PDL Job commands - Start, End and Display. | Add the Software Upgrade enable/disable setting to the Config Report |
| EOJ command truncates the Job Name | IPv4 Filtering not working correctly with wildcards |
| PDL USTATUS functionality for a cancelled job | Network |
| PDL USTATUS PAGE messages for duplex jobs should not start on page 0 | SLP Multicast IP set to off continues to answer. |
| A Postscript font file sent to the 3600 with the location set to flash does not download properly | Printers dropping off the network |
| When a print job is canceled at the device the PDL INFO STATUS CODE is incorrect. | Misc |
| PDL INFO USTATUS and INFO VARIABLES messages have items that are incorrect | The xcmHrDevPowerEnergySaveDelay.1 MIB object is not working. |
| Postscript Page takes 15 seconds between pages to print | Remote suppression of toner low/reorder appearing at UI |
| Printer does not process HPGL commands to print text | Need MIB setting for Eelectronic Labeling feature. |
| Printer is rebooting with a PDF file. | Fix pattern cache problem. |
| Printer needs to support IPP document formats for postscript, PCL, and text/plain | Multiple copies specified in Oracle print job control file is producing a single copy print out |
| Printer truncates the JOB NAME in the EOJ response when the name is 80 Characters | When printing from special POD application the image is rotated and cropped |
| PS job doesn't print | Configuration report updated to reflect upgrade status |
| Postscript error of string over write | Logo is drawn as lines and not the logo |
| Did not print after receiving x'14' | Verify the Download mode of the Printer |
| | Verify the SNMP Community Name using MIB Browser |

I. Installation Notes

Firmware located on xerox.com

II. Installation Instructions

CentreWare Internet Services (CWIS) Procedure for upgrading firmware on a Phaser 3600 printer:

1. Copy the Phaser 3600 firmware file to your computer. If the file is in a .zip format, unzip the file.
2. Open Internet Explorer or other Browser application. Type in the IP address of the Phaser 3600 to be upgraded (example: "<http://12.345.67.890/>"). Press the Enter key to connect to the printer.
3. Select the Print button. Select File Download under Print options (left side of screen).
4. Within the "File Download" screen, select "Browse" to access the location on your computer where you have placed the firmware file. Select the file and Enter.
5. Select the blue button below the filename window to begin the file download to the printer. A "pop-up" window will be displayed showing the file download status.
6. Once the file has been downloaded to the printer, the screen will show "End of Download". Select OK to close the message window.
7. The firmware file will be installed on the printer.
8. You may print a Configuration Page to confirm the new firmware file version has been installed. To do this from the browser window select "Print -> Print Configuration Pages", select "Printer Configuration Page" then the blue button. Please refer to the "Firmware Version" title on the printed configuration page.
9. You can now close the CWIS window.